



## USE AND MAINTENANCE MANUAL

TRANSLATION OF THE ORIGINAL INSTRUCTIONS — ENGLISH

# NEW MAGIC WELD

- Motosaldatrice
- Engine Driven Welder
- Motosoudeuse
- Motosoldadoras
- Schweißaggregat
- Motosoldadora
- По Вышкам

Codice  
Code  
Code  
Codigo  
Kodezahl  
Código  
Код

222629003

Edizione  
Edition  
Édition  
Edición  
Ausgabe  
Edição  
Издание

01.2016




MADE IN ITALY



# MOSA Weld



The Engine Driven Welder is a block with an engine, an aluminium casting and a front panel. Inside the casting there are all electrical components of the machine: a permanent magnet alternator, a high frequency chopper diode bridge, an electronic control board and an electromagnet.

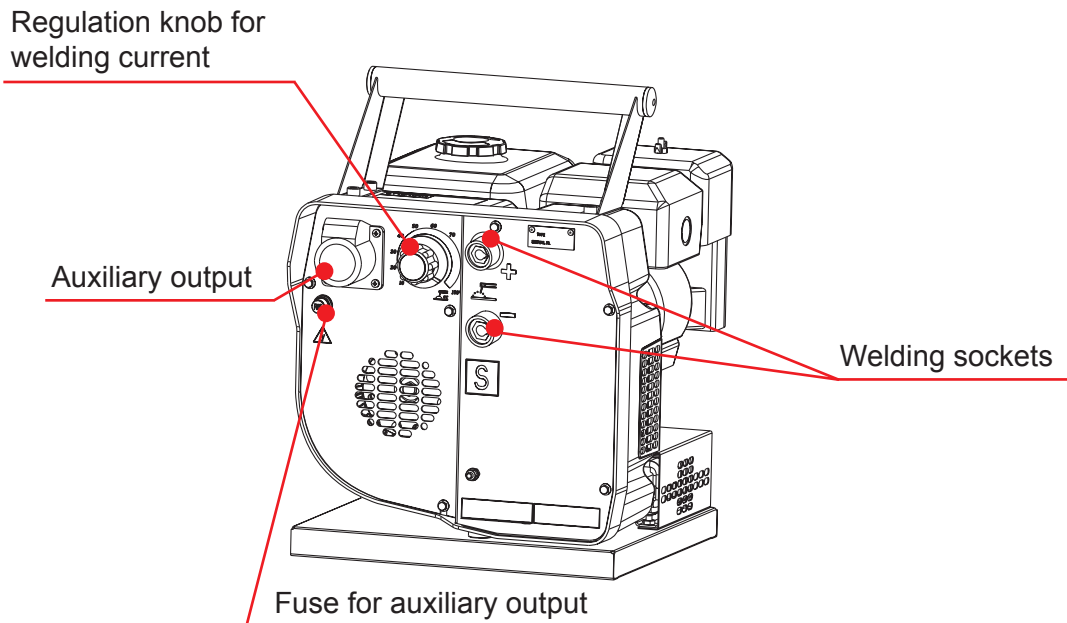

### Electrical components of the machine:

- Permanent magnet alternator: the alternator has 2 galvanically separated windings, one for welding and the other for the auxiliary output.
- Auto idle solenoid: an electromagnet inside the aluminium casting is supplied at no load only and forces the engine speed at minimum (2000 rpm). When the load is present, welding or auxiliary output, the electromagnet is not supplied any more and the engine speed goes to the maximum (4000 rpm rated open circuit).
- High frequency chopper diode bridge: it regulates the welding current using the “Chopper System”, which chops the welding D.C. current at high frequency.
- Hall sensor: it measures with high precision the welding current and it's completely isolated from the welding circuit.
- Reactance for cellulose electrodes (optional).
- PWM control board: this single board controls the welding process, the auxiliary current and the electromagnet for the engine accelerator. Three integrated circuits PWM type (Pulse Width Modulation) have been used. The use of these PWM's not only for the welding control but also for the supply control of the electromagnet reduces to the minimum the wasted power on the electromagnet.
- D.C. chopped auxiliary output: the auxiliary output is chopped every 50 msec. in order to prevent damages to switches of hand tools due to arcing. This special D.C. auxiliary is suitable not only for universal hand tools with brushes, but also for those with electronic speed control. In this case the limit is that these tools can run at the maximum speed only, without possibility of speed regulation.

M 1.01	COPYRIGHT
M 1.1	NOTES
M 1.4	CE MARK
M 1.5	TECHNICAL DATA
M 2	ADVICE
M 2.1	SYMBOLS
M 2.2	ADVICE ENGINE DRIVEN WELDER
M 2.3	SYMBOLS - ABBREVIATIONS LEGEND
M 2.6	INSTALLATION AND ADVICE
M 2.7	INSTALLATION
M 2.7.1	DIMENSIONS
M 3	UNPACKING AND TRANSPORT
M 25	SET-UP FOR OPERATION
M 26	ENGINE STARTING
M 27	STOPPING THE ENGINE
M 31	CONTROLS
M 34...	USE AS A WELDER
M 37	USE AS A GENERATOR
M 40.2...	TROUBLE-SHOOTING
M 43	MAINTENANCE
M 45	STORAGE - CUST OFF
M 55	RECOMMENDED ELECTRODES
M 60	ELECTRICAL SYSTEM LEGENDE
M 61-.....	ELECTRICAL SYSTEM



## ATTENTION

This use and maintenance manual is an important part of the machines in question.

The assistance and maintenance personnel must keep said manual at disposal, as well as that for the engine and alternator (if the machine is synchronous) and all other documentation about the machine.

We advise you to pay attention to the pages concerning the security (see page M1.1).



© All rights are reserved to said Company.

It is a property logo of MOSA division of B.C.S. S.p.A. All other possible logos contained in the documentation are registered by the respective owners.

🚫 The reproduction and total or partial use, in any form and/or with any means, of the documentation is allowed to nobody without a written permission by MOSA division of B.C.S. S.p.A.

To this aim is reminded the protection of the author's right and the rights connected to the creation and design for communication, as provided by the laws in force in the matter.

In no case MOSA division of B.C.S. S.p.A. will be held responsible for any damage, direct or indirect, in relation with the use of the given information.

MOSA division of B.C.S. S.p.A. does not take any responsibility about the shown information on firms or individuals, but keeps the right to refuse services or information publication which it judges discutible, unright or illegal.

## INFORMATION

Dear Customer,  
We wish to thank you for having bought a high quality set.

Our sections for Technical Service and Spare Parts will work at best to help you if it were necessary.

To this purpose we advise you, for all control and overhaul operations, to turn to the nearest authorized Service Centre, where you will obtain a prompt and specialized intervention.

☞ In case you do not profit on these Services and some parts are replaced, please ask and be sure that are used exclusively original parts; this to guarantee that the performances and the initial safety prescribed by the norms in force are re-established.

☞ *The use of **non original spare parts will cancel immediately any guarantee and Technical Service obligation.***

## NOTES ABOUT THE MANUAL

Before actioning the machine please read this manual attentively. Follow the instructions contained in it, in this way you will avoid inconveniences due to negligence, mistakes or incorrect maintenance. The manual is for qualified personnel, who knows the rules: about safety and health, installation and use of sets movable as well as fixed.

You must remember that, in case you have difficulties for use or installation or others, our Technical Service is always at your disposal for explanations or interventions.

The manual for Use Maintenance and Spare Parts is an integrant part of the product. It must be kept with care during all the life of the product.

In case the machine and/or the set should be yielded to another user, this manual must also given to him.

Do not damage it, do not take parts away, do not tear pages and keep it in places protected from dampness and heat.

You must take into account that some figures contained in it want only to identify the described parts and therefore might not correspond to the machine in your possession.

## INFORMATION OF GENERAL TYPE

In the envelope given together with the machine and/or set you will find: the manual for Use Maintenance and Spare Parts, the manual for use of the engine and the tools (if included in the equipment), the guarantee (in the countries where it is prescribed by law).

The Manufacturer shall not be liable for ANY USE OF THE PRODUCT OTHER THAN THAT PRECISELY SPECIFIED IN THIS MANUAL and is thus not liable for any risks which may occur as a result of IMPROPER USE. The Company does not assume any liability for any damage to persons, animals or property.

Our products are made in conformity with the safety norms in force, for which it is advisable to use all these devices or information so that the use does not bring damage to persons or things.

While working it is advisable to keep to the personal safety norms in force in the countries to which the product is destined (clothing, work tools, etc.).

Do not modify for any motive parts of the machine (fastenings, holes, electric or mechanical devices, others..) if not duly authorized in writing: the responsibility coming from any potential intervention will fall on the executioner as in fact he becomes maker of the machine.

☞ **Notice:** *the manufacturer, who keeps the faculty, apart the essential characteristics of the model here described and illustrated, to bring betterments and modifications to parts and accessories, without putting this manual uptodate immediately.*



Any of our product is labelled with CE marking attesting its conformity to applicable directives and also the fulfillment of safety requirements of the product itself; the list of these directives is part of the declaration of conformity included in any machine standard equipment.

Here below the adopted symbol:



CE marking is clearly readable and unerasable and it can be either part of the data-plate.


	Made in UE-ITALY	TYPE	
	SERIAL N°		
	X		
	I <sub>2</sub> (A)		
	U <sub>0</sub>	U <sub>2</sub> (V)	
	I <sub>2</sub> (A)		
	U <sub>0</sub>	U <sub>2</sub> (V)	
	Hz	kVA	
	P.F.	V (V)	
		I (A)	
	n	RPM	n <sub>1</sub>
	n <sub>0</sub>	RPM	P <sub>1max</sub>
		IP	
		KW	I. CL.

	Made in UE-ITALY	TYPE	
	Generating Set ISO 8528	SERIAL N°	
	KVA		
	V		
	I		
	Hz	P.F.	LTP POWER IN ACCORDANCE WITH ISO 8528
	RPM	I. CL.	IP
	ALTIT. 100 m	TEMP. 25 °C	MASS

	TYPE	
	SERIAL N°	Made in UE-ITALY
	TYPE/N°	
	VOLTAGE(V)	
	POWER(W)	
	Hz	KVA
	P.F.	V(V)
	I.C.L.	I(A)
	LTP POWER IN ACCORDANCE WITH ISO 8528	
	n	RPM
	P <sub>max</sub>	TEMP. °C
		ALTIT. m
		IP
		Kg

	Made in UE-ITALY	I. CL.	
	IEC 60974-1	IP	
	U <sub>0</sub>		
	X	I <sub>2</sub>	U <sub>2</sub>
	n	RPM	n <sub>1</sub>
	n <sub>0</sub>	RPM	P <sub>1max</sub>
		RPM	kw
	P	V	I

Furthermore, on each model it is shown the noise level value; the symbol used is the following:

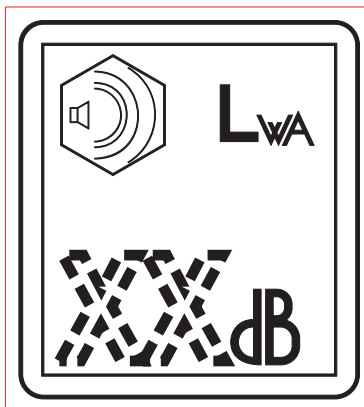

The indication is shown in a clear, readable and indeleble way on a sticker.



**Technical data**

**NEW MAGIC WELD**

**D.C. WELDING**

Current range, continuous	30 - 150A
Open circuit voltage	67V
Duty cycle	150 A - 60%

**D.C. GENERATION**

Single-phase output (max)	2 kW / 230 V c.c./ 8.7 A
Single-phase output (continuous)	1.6 kW / 230 V / 6.9 A

**ALTERNATOR**

Type	Self-excited, self-regulated, brushless
Insulating class	permanent magnet H

**ENGINE**

Mark / Model	HONDA / GX 200
Type / Cooling system	Gasoline / 4-stroke / Air
Cylinders / Displacement	1 / 196 cm <sup>3</sup>
Output max	4 kW (5.5 HP)
Speed	4000 rpm
Fuel consumption (welding 60%)	1.1 l/h
Engine oil capacity	0.6 l
Starter	recoil

**GENERAL SPECIFICATIONS**

Tank capacity	3.1 l
Running time (welding 60%)	3 h
Protection	IP 23
* Dimensions max. on base LxH	435x375x490
* Weight (dry)	34 Kg
** Noise level L <sub>WA</sub> (pression L <sub>pA</sub> )	99 db(A) (74 dB (A) @ 7 m)

\* Dimensions and weight are inclusive of all parts. \*\* For fixed installation only in the EU market.

**POWER**

Declared power according to ISO 3046-1 (temperature 25°C, 30% relative humidity, altitude 100 m above sea level).

It's admitted overload of 10% each hour every 12 h.

In an **approximative** way one reduces: of 1% every 100 m altitude and of 2.5% for every 5°C above 25°C.

**ACOUSTIC POWER LEVEL**

**ATTENTION:** The concrete risk due to the machine depends on the conditions in which it is used. Therefore, it is up to the end-user and under his direct responsibility to make a correct evaluation of the same risk and to adopt specific precautions (for instance, adopting a I.P.D. -Individual Protection Device)

**Acoustic Noise Level (L<sub>WA</sub>) - Measure Unit dB(A):** it stands for acoustic noise released in a certain delay of time. This is not submitted to the distance of measurement.

**Acoustic Pressure (L<sub>p</sub>) - Measure Unit dB(A):** it measures the pressure originated by sound waves emission. Its value changes in proportion to the distance of measurement.


The here below table shows examples of acoustic pressure (L<sub>p</sub>) at different distances from a machine with Acoustic Noise Level (L<sub>WA</sub>) of 95 dB(A)

L<sub>p</sub> a 1 meter = 95 dB(A) - 8 dB(A) = 87 dB(A)


L<sub>p</sub> a 4 meters = 95 dB(A) - 20 dB(A) = 75 dB(A)

L<sub>p</sub> a 7 meters = 95 dB(A) - 25 dB(A) = 70 dB(A)


L<sub>p</sub> a 10 meters = 95 dB(A) - 28 dB(A) = 67 dB(A)

**PLEASE NOTE:** the symbol  when with acoustic noise values, indicates that the device respects noise emission limits according to 2000/14/CE directive.



 The installation and the general advice concerning the operations, are finalized to the correct use of the machine, in the place where it is used as generator group and/or welder.

- Advice to the User about the safety:

 **N.B.:** The information contained in the manual can be changed without notice. Potential damages caused in relation to the use of these instructions will not be considered because these are only indicative. Remember that the non observance of the indications reported by us might cause damage to persons or things. It is understood, that local dispositions and/or laws must be respected.

 **DANGEROUS**

This heading warns of an immediate danger for persons as well for things. Not following the advice can result in serious injury or death.

 **WARNING**

This heading warns of situations which could result in injury for persons or damage to things.

 **CAUTION**



To this advice can appear a danger for persons as well as for things, for which can appear situations bringing material damage to things.

 **IMPORTANT**



 **NOTE**

These headings refer to information which will assist you in the correct use of the machine and/or accessories.

 **ATTENTION**

  **FIRST AID.** In case the operator should be sprayed by accident, from corrosive liquids a/o hot toxic gas or whatever event which may cause serious injuries or death, predispose the first aid in accordance with the ruling labour accident standards or of local instructions.

Skin contact	Wash with water and soap
Eyes contact	Irrigate with plenty of water, if the irritation persists contact a specialist
Ingestion	Do not induce vomit as to avoid the intake of vomit into the lungs, send for a doctor
Suction of liquids from lungs	If you suppose that vomit has entered the lungs (as in case of spontaneous vomit) take the subject to the hospital with the utmost urgency
Inhalation	In case of exposure to high concentration of vapours take immediately to a non polluted zone the person involved

  **FIRE PREVENTION.** In case the working zone, for whatsoever cause goes on fire with flames liable to cause severe wounds or death, follow the first aid as described by the ruling norms or local ones.

EXTINCTION MEANS	
Appropriated	Carbonate anhydride (or carbon dioxide) powder, foam, nebulized water
Not to be used	Avoid the use of water jets
Other indications	Cover eventual shedding not on fire with foam or sand, use water jets to cool off the surfaces close to the fire
Particular protection	Wear an autorespiratory mask when heavy smoke is present
Useful warnings	Avoid, by appropriate means to have oil sprays over metallic hot surfaces or over electric contacts (switches, plugs, etc.). In case of oil sprinkling from pressure circuits, keep in mind that the inflammability point is very low.

## SYMBOLS IN THIS MANUAL

- The symbols used in this manual are designed to call your attention to important aspects of the operation of the machine as well as potential hazards and dangers for persons and things.

This symbol is used to draw your attention to the fact that the welder is being used correctly and that the machine or equipment used operates perfectly.



**STOP** - Read absolutely and be duly attentive



**HIGH VOLTAGE** - Attention High Voltage. There can be parts in voltage, dangerous to touch. The non observance of the advice implies life danger.



**FIRE** - Danger of flame or fire. If the advice is not respected fires can happen.



**HEAT** - Hot surfaces. If the advice is not respected burns or damage to things can be caused.



**EXPLOSION** - Explosive material or danger of explosion. in general. If the advice is not respected there can be explosions.



**WATER** - Danger of shortcircuit. If the advice is not respected fires or damage to persons can be caused.



**SMOKING** - The cigarette can cause fire or explosion. If the advice is not respected fires or explosions can be caused.



**WRENCH** - Use of the tools. If the advice is not respected damage can be caused to things and even to persons.



**ACCES FORBIDDEN** to non authorized people.

### Use only with safety clothing -



It is compulsory to use the personal protection means given in equipment.

### Use with safe materials only -



Never use water to put out fires on electrical equipment

### Use only with non inserted voltage -



It is prohibited to make interventions before having disinserted the voltage.

### No smoking -



It is prohibited to smoke while filling the tank with fuel.

### Do not refuel -



Do not refuel when the engine is hot.



Switch off the engine prior to refuelling.

### Fire -



Fuel can cause fires.

### Use only with safety protections -



It is advisable to use all protections while shifting the machine.

### Use only with safety protections -



It is advisable to use protections suitable for the different daily checking works and/or of maintenance.

### Exhaust gases -



Exhaust gases from the engine can kill.

### Petrol vapours -








 










Petrol vapours cause fires and can seriously damage your health.

### Moving parts -


 




 



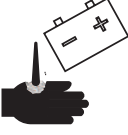





Moving parts are dangerous. Avoid touching any moving parts with your hands or fingers. Never wear loose clothing which may get trapped by moving parts.

### ARC WELDING HAZARDS

	<p>Electric shock from welding electrode or wiring can kill.</p>		<p>Welding sparks can cause fires. Have a fire extinguisher nearby, and have a trained fire watcher ready to use it.</p>
	<p>Wear dry, hole-free insulating gloves and body protection. Do not touch electrode with bare hand. Do not wear wet or damaged gloves. Do not touch live electrical parts. Wet or confined spaces, or if their is una danger of falling. Use AC output ONLY if required for the welding process. If AC output is required, use remote output control if present on unit.</p>		<p>Arc rays can burn eyes and skin.</p>
	<p>Magnetic fields can affect pace-makers. Pace-maker wearers keep away from arc welding and cutting operations and equipment. Wearers should consult their doctor before going near arc welding, gouging, arc cutting, or spot welding operations.</p>		<p>Use welding helmet with correct shade of filter.</p>
	<p>Protect yourself from electric shock by insulating yourself from work and ground. Use non-flammable, dry insulating material if possible, or use dry rubber amts, dry wood or plywood, or other dry insulating material big enough to cover your full area of contract with the work or ground, and watch for fire.</p>		<p>Wear welders cap and safety glasses with side shields. Use ear protection when welding out of position or in confined spaces. Button shirt collar.</p>
	<p>Breathing welding fumes can be hazardous to your health.</p>		<p>Wear complete body protection. Wear oil free protective clothing such as leather gloves, heavy shirt, cuffless pants, and hight boots.</p>
	<p>Protect yourself from electric shock by insulating yourself from work and ground. Use non-flammable, dry insulating material if possible, or use dry rubber amts, dry wood or plywood, or other dry insulating material big enough to cover your full area of contract with the work or ground, and watch for fire.</p>		<p>Use enough forced ventilation or local exhaust (forced suction) at the arc to remove the fumes from your breathing area.</p>
	<p>Use a ventilating fan to remove fumes from the breathing zone and welding area. If adequancy of ventilation or exhaust is uncertain, have the air quality checked.</p>		<p>Welding can cause fire or explosion.</p>
	<p>Do not weld near flammable material. Move flammanles at least (10 m) away or protect them with flame-proof covers.</p>		<p>Do not weld on drums, tanks, or any closed containers unless a qualified person has tested it and declared it or prepared it to be safe.</p>



## ENGINE HAZARDS

	Fuel can cause fire or explosion..
	Engine fuel plus flames or sparks can cause fire or explosion. Do not weld near engine fuel. Do not spill fuel. If fuel is spilled, clean it up and do not start engine until fumes are gone.
	Do not smoke while fueling or if near fuel or fumes.
	STOP engine before fueling.
	DO NOT fuel a hot engine. Stop engine and let it cool off before checking or adding fuel.
	Engine exhaust gases can kill.
	Vent exhaust outside and away from any building air intakes.
	Use unit outside in open, well ventilated areas.
	Moving parts can cause injury. Keep hands, hair, loose clothing, and tools away from moving parts such as fans, belts, and rotors. Keep all doors, panels, and guards closed and secured.
	Battery explosion can blind. Sparks can cause battery gases to explode. Do not smoke and keep matches and flames away from battery. Wear a face shield or safety glasses when working near or on a battery.
	Battery acid can burn skin and eyes. Do not spill acid. Wear rubber gloves and a face shield or safety glasses when working on a battery.
	Steam and hot coolant can burn. Check coolant level when engine is cold to avoid scalding. If the engine is warm and checking is needed, wear safety glasses and gloves and put a rag over radiator cap. Turn cap slightly and let pressure escape slowly before completely removing cap.

	Exhaust sparks can cause fire. Use approved engine exhaust spark arrestor in required areas. Keep exhaust and exhaust pipes away from flammables. Do not locate unit near flammables.
	Hot parts can cause severe burns. Do not touch hot welder with bare hand. If handling is needed, use proper tools and/or wear heavy, insulated welding gloves to prevent burns. Allow cooling period before handling parts or working on gun or torch.


**INSTALLATION AND ADVICE BEFORE USE**

Use in open space, air swept or vent exhaust gases, which contain the deadly carbone oxyde, far from the work area.

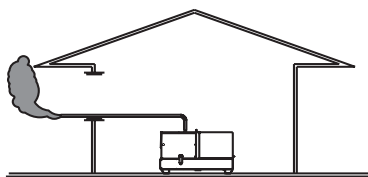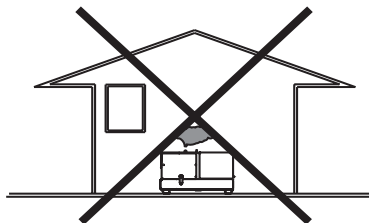


**POSITION**

Place the machine on a level surface at a distance of at least 1,5 m from buildings or other plants.

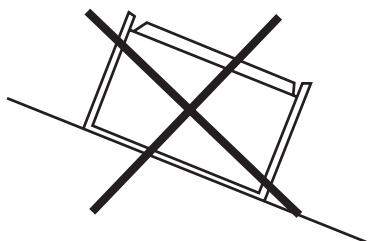

Check that the air gets changed completely and the hot air sent out does not come back inside the set so as to cause a dangerous increase of the temperature.

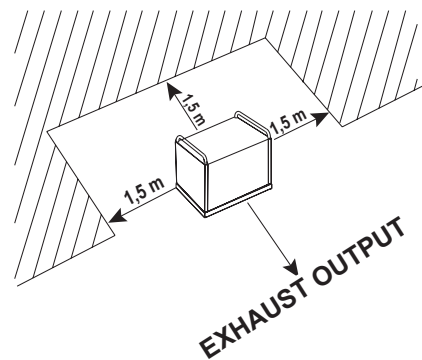

Make sure that the machine does not move during the work: **block** it possibly with tools and/or devices made to this purpose.

**MOVES OF THE MACHINE**

At any move check that the engine is **off**, that there are not connections with cables which impede the moves.


**PLACE OF THE MACHINE AND/OR EQUIPMENTS**




**ATTENTION**



For a safer use from the operator **DO NOT** fit the machine in locations with high risk of flood  
Please do not use the machine in weather conditions which are beyond IP protection shown both in the data plate and on page named "technical data" in this same manual.


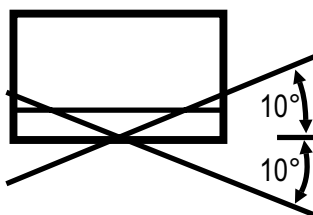






$\alpha = 20^\circ \text{ max}$

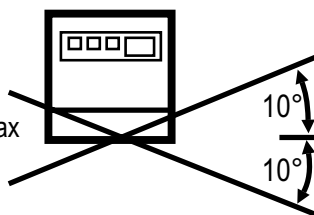



$\beta = 20^\circ \text{ max}$

Maximum leaning of the machine (in case of dislevel)

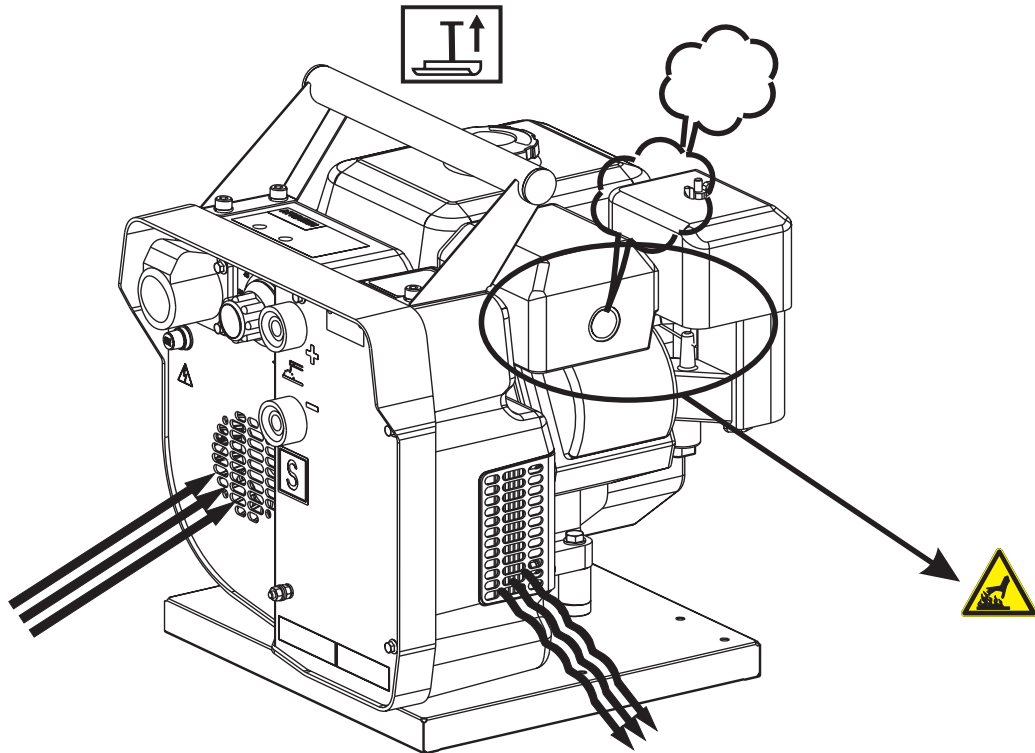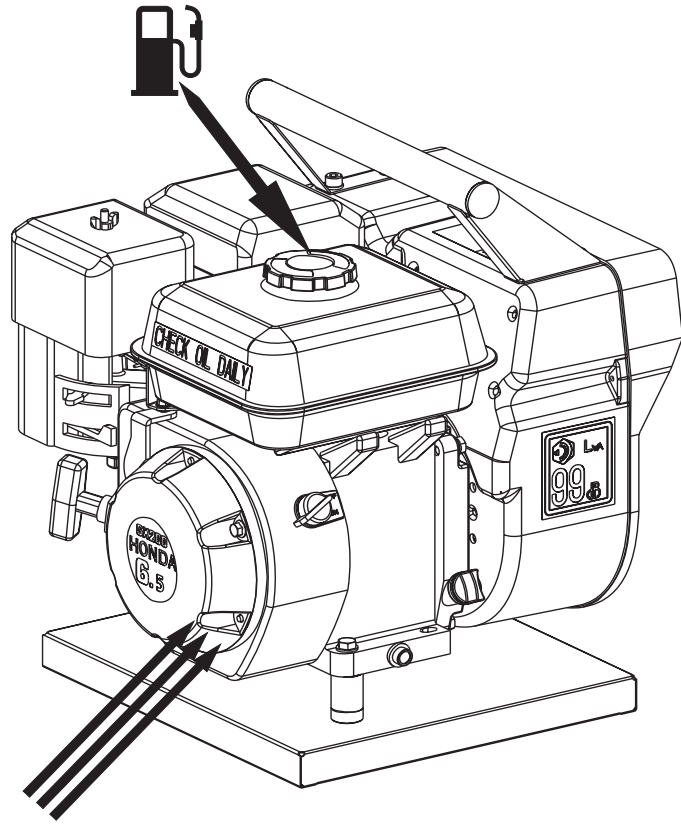

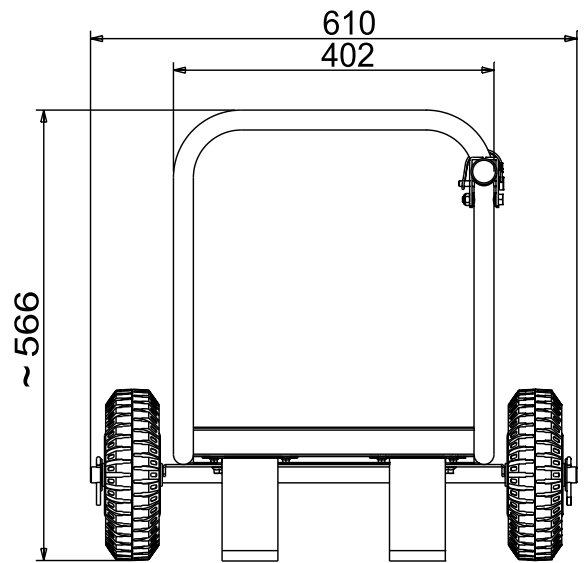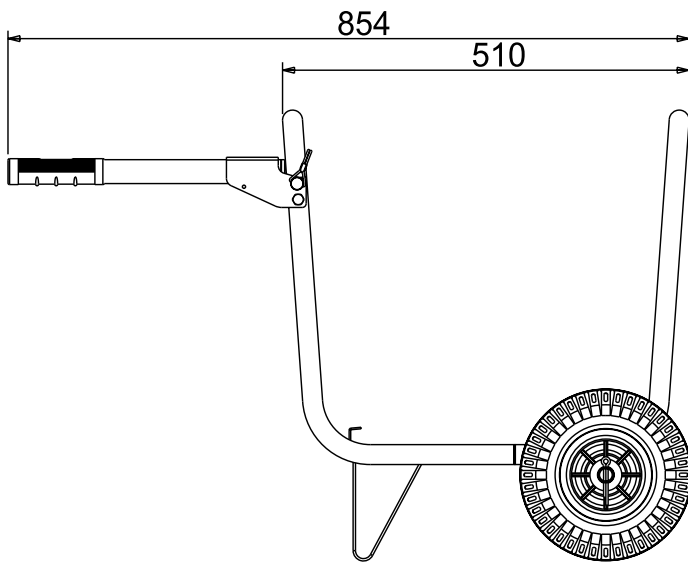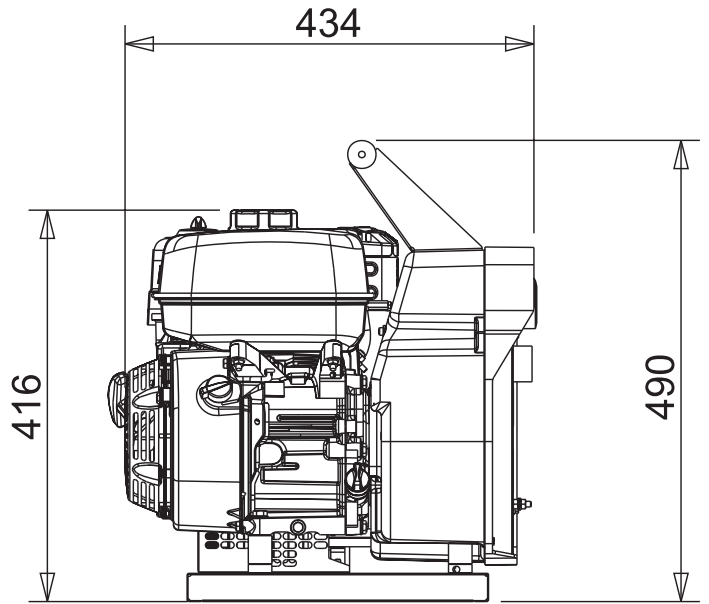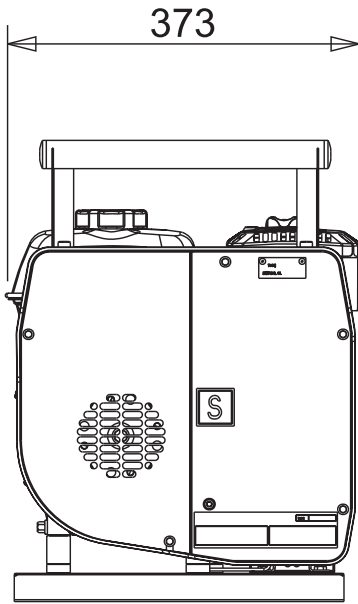

**! NOTE**

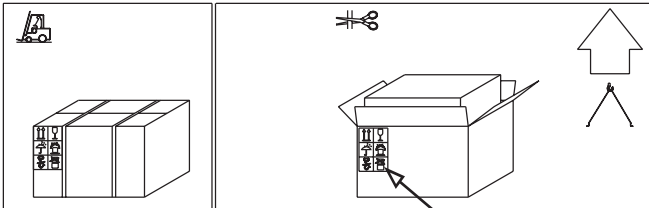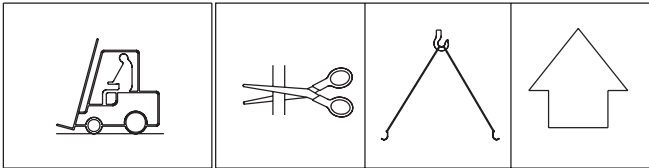


Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with its packaging, and conforms to local rules and regulations. When receiving the goods make sure that the product has not suffered damage during the transport, that there has not been rough handling or taking away of parts contained inside the packing or in the set.


In case you find damages, rough handling or absence of parts (envelopes, manuals, etc.), we advise you to inform immediately our Technical Service.




For eliminating the packing materials, the User must keep to the norms in force in his country.

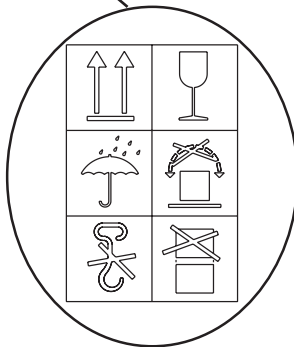

- 1) Take the machine (C) out of the shipment packing. Take out of the envelope (A) the user's manual (B).
- 2) Fit the handle as shown in the instructions (fitting: screws and spanner are supplied).
- 3) Read: the user's manual (B), the plates fixed on the machine, the data plate.

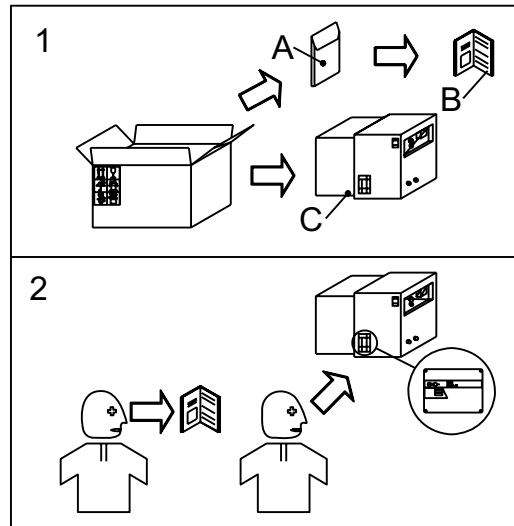


In case you should transport or move the machine, keep to the instructions as per the figures. Be sure that the lifting devices are: correctly mounted, adequate for the weight of the machine with its packaging, and conform to local rules and regulations. Only authorized persons involved in the transport of the machine should be in the area of movement.

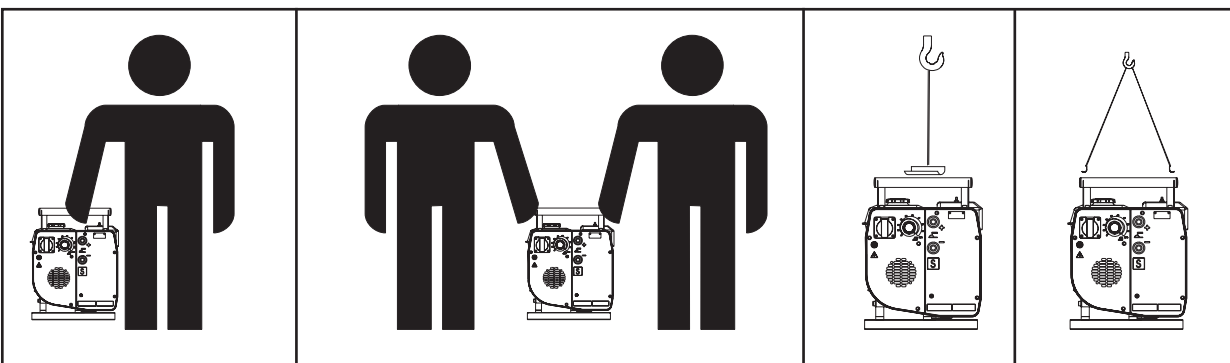



**Note:** Lift the machine and assemble the parts as shown in the drawing

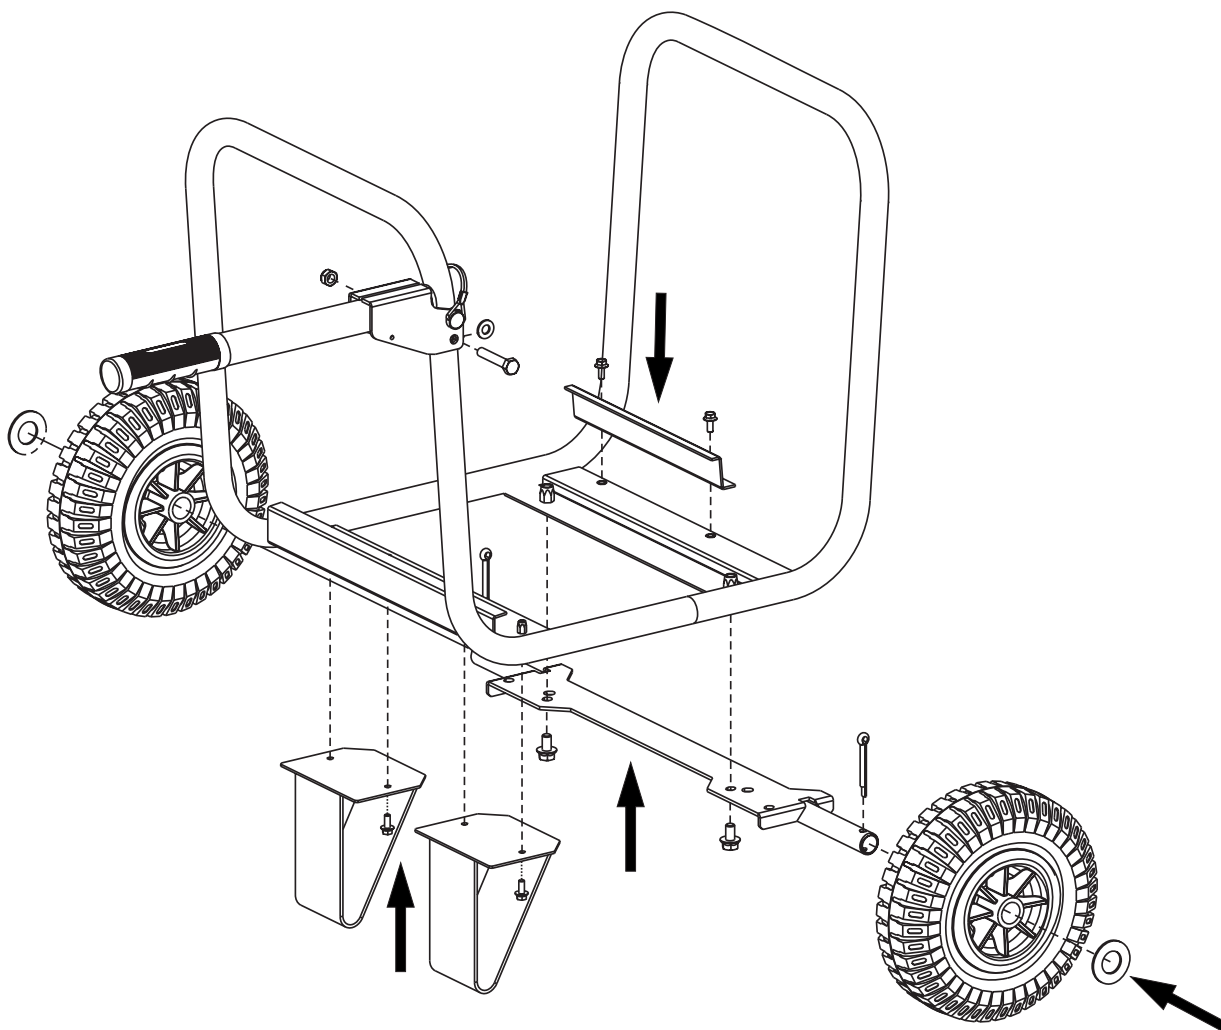

### ATTENTION

The CTM accessory cannot be removed from the machine and used separately (actioned manually or following vehicles) for the transport of loads or anyway for used different from the machine movements.





## LUBRICANT

Please refer to the motor operating manual for the recommended viscosity.

### RECOMMENDED OIL

The manufacturer recommends selecting **AGIP** engine oil.


Refer to the label on the motor for the recommended products.

 PRODOTTI RACCOMANDATI RECOMMENDED PRODUCTS	
<b>AGIP SIGMA TURBO PLUS 15W/40</b> API CG4 - ACEA E3	OLIO MOTORE DIESEL DIESEL ENGINE OIL
<b>AGIP SUPERMOTOROIL 20W/50</b> API CC-SF	OLIO MOTORE BENZINA GASOLINE ENGINE OIL
<b>AGIP ANTIFREEZE EXTRA</b> INIBITE ETHYLENE GLYCOL (50% + 50% + H <sub>2</sub> O)	CIRCUITO DI RAFFREDDAMENTO COOLING CIRCUIT (CUNA NC 956-16 ED 97)

To check the oil level:

1. Remove the oil-fill tap (24) and clean the dip-stick (23).
2. Insert the dip-stick into the oil filler without screwing it in.
3. If the oil level is low, fill with recommended oil up to the top of the oil filler

Oil fill tap / dip-stick

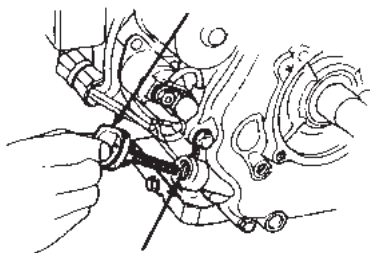

Upper oil level

### MOTORS WITH OIL ALERT DEVICE

The "Oil Alert" system is designed to prevent damage to the motor due to an insufficient quantity of oil in the cup. This system automatically shuts off the motor before the oil level falls below the safety limit. If the motor does not start up again after shutting itself off, check the oil level.



## FUEL



## ATTENTION



Gasoline is highly flammable. Refuel with motor shut off in a flat surfaced well-ventilated area. Do not refuel in the presence of flames. Avoid spilling fuel.



Any eventual spilled fuel and fumes are flammable. Clean any dispersions of fuel before starting up the motor.



Fill the tank with gasoline for automobiles (preferably lead free or with low lead content in order to reduce deposits in the combustion chamber to a minimum).

For further details on the type of gasoline to use, see the motor operating manual supplied.

Do not fill the tank completely; leave a space of approx. 10 mm between the fuel level and the wall of the tank to allow for expansion.



### AIR FILTER

Check that the dry air filter is correctly installed and that there are no leaks around the filter which could lead to infiltrations of non-filtered air to the inside of the motor.



### WARNING


**Do not use the machine if it is not in good technical condition**

The machine must be in good working order before being used. Defects, especially those which regard the safety of the machine, must be repaired before using the machine.

**Do not use without protective devices provided**

Removing or disabling protective devices on the machine is prohibited.



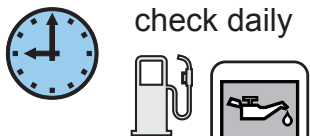


check daily

**NOTE**


Do not alter the primary conditions of regulation and do not touch the sealed parts.

1. Turn the fuel cock (87) to ON.

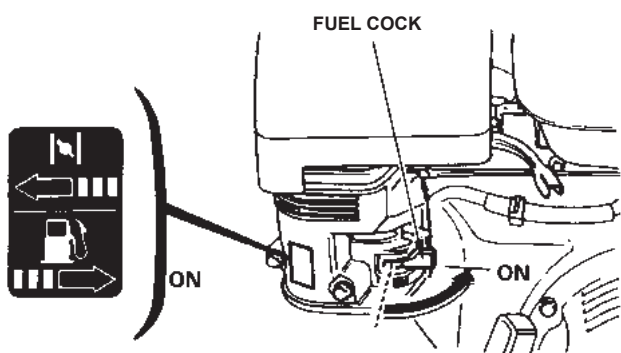


2. Switch the choke control (66) to CLOSE

**N.B.:** Do not use the air valve if the motor is hot or the air temperature is too high.

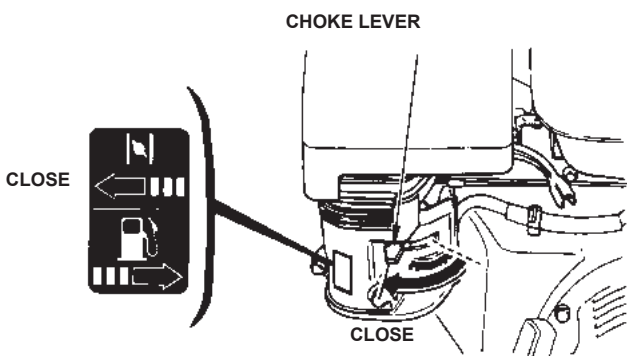


3. Turn the engine switch (28) to the ON position

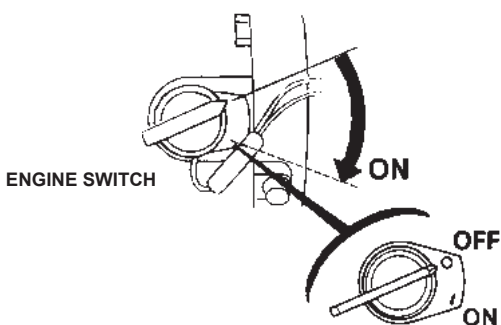

Lightly pull the start-up knob (73) until meeting resistance, then pull decisively.

**ATTENTION:**

Allow the start-up knob to re-enter slowly, avoiding having it knock against the motor and thereby damaging the start-up system.

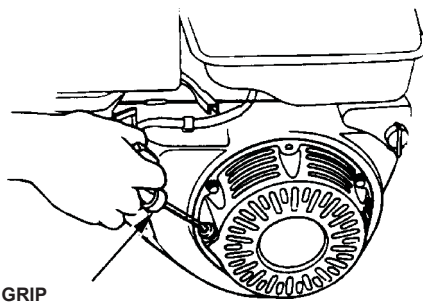

4. When the engine is started the machine reaches maximum engine speed immediately (4000 rpm) for 6/7 seconds, after which the engine speed automatically decreases to minimum (2000 rpm). The minimum is set by the solenoid which acts on the accelerator lever.

5. The engine reaches maximum speed only when current is drawn in welding or auxiliary power mode.


Before stopping the engine **it is compulsory:**

- Disconnect or close any power load connected to the system's auxiliary generation.
- Interrupt welding.






**To shut down the motor:**

For shut down the motor in case of emergency, turn the motor switch (28) to OFF.  
In normal conditions, wait for the engine to reach minimum speed automatically 6/7 seconds after the load has been excluded. Turn the engine in these conditions for a few minutes so that it can cool down and then turn the engine switch (28) to OFF.

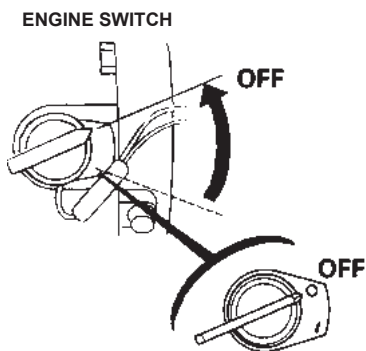

Turn the fuel valve to the OFF position.

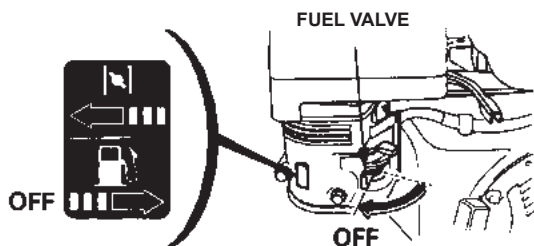

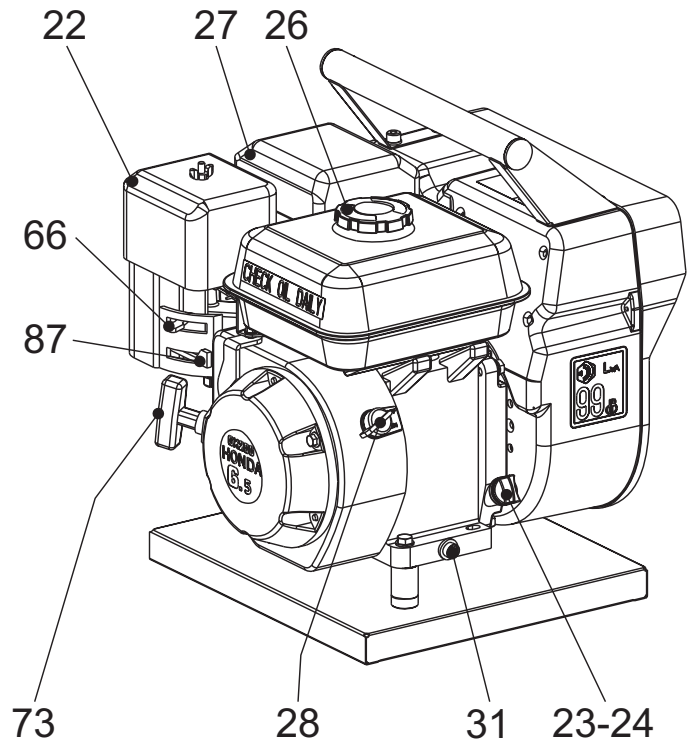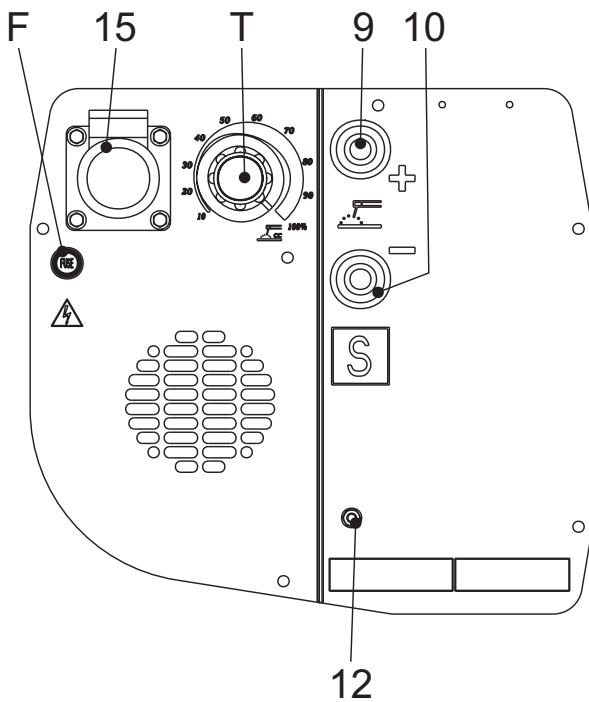

Pos.	Descrizione	Description	Description	Descripción
9	Prese di saldatura (+)	Welding sockets (+)	Prises de soudage (+)	Tomas de soldadura (+)
10	Prese di saldatura (-)	Welding sockets (-)	Prises de soudage (-)	Tomas de soldadura (-)
12	Presa di messa a terra	Earth terminal	Prise de mise à terre	Toma de puesta a tierra
15	Presa di corrente in c.c.	d.c. socket	Prises de courant en c.c.	Toma de corriente en c.c.
22	Filtro aria motore	Engine air filter	Filtre air moteur	Filtro aire motor
23	Asta livello olio motore	Oil level dipstick	Jauge niveau huile moteur	Aguja nivel aceite motor
24	Tappo caricamento olio motore	Engine oil reservoir cap	Bouchon remplissage huile moteur	Tapón llenado aceite motor
26	Tappo serbatoio	Fuel tank cap	Bouchon réservoir	Tapón depósito
27	Silenziatore di scarico	Muffler	Silencieux d'échappement	Silenciador de descarga
28	Comando stop	Stop control	Commande stop	Mando stop
31	Tappo scarico olio motore	Oil drain tap	Bouchon décharge huile moteur	Tapón vaciado aceite motor
66	Comando choke	Choke button	Bouton Choke	Pulsador Choke
73	Comando manuale avviamento	Starting push button	Commande manuelle démarrage	Mando manual arranque
87	Rubinetto carburante	Fuel cock	Robinet de l'essence	Grifo de combustible
F	Fusibile	Fuse	Fusible	Fisible
T	Regolatore corrente di saldatura	Welding current regulator	Régulateur courant soudage	Regulador corr. de soldadura




## WARNING

Areas for which access by non-authorized personnel is **forbidden** are:

- the control panel (at the front) - the endothermic motor discharge.

## CONNECT WELDING CABLES

Insert the welding cable plugs completely in the sockets, turning clockwise to lock them in place.

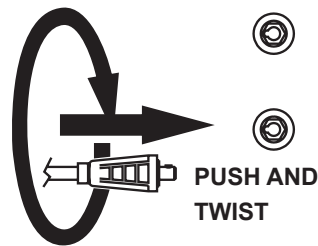


Connect the earth clamp to the negative pole and the electrode holder to the positive.

☞ Pay attention to the two polarities on the welding circuit, which must not come into electrical contact with each other.

- Carefully tighten the output cables to the bushings; if loose, they can cause problems of overheating and damage the bushings, cables, etc.
- Make certain the grounding pincer is connected as near as possible to the work station.

## ADJUSTING THE WELDING CURRENT

The welding current is regulated by turning knob "T" continuously. If set to the minimum (turned fully in an anticlockwise direction) it provides a current of approximately 30 A; if set to the maximum (turned fully in a clockwise direction) it gives a maximum current of approximately 150A.

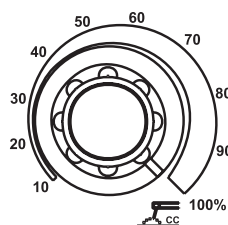

## RECOMMENDED ELECTRODES

All the electrodes on the market can be used, however for cellulose electrodes we recommend Magic Weld with added reactor.



## ATTENTION

To reduce the risk of electromagnetic interference, keep the welding cable length short and keep them on or near the ground. If possible, welding operations should not be done near sensitive electronic devices. If interference continues to occur, adopt additional measures: shift the group, use shielded cables, line filters, shield the entire work area.

If the above solutions do not suffice, consult our Technical Servicing Department.

## AUTO IDLE

### Operation

When the engine is switched on it immediately reaches a maximum speed of 4000 rpm for approximately 6/7 seconds for easy start up, after which it automatically decreases and idles at 2000 rpm. It remains at this speed until current is drawn when set to weld or auxiliary power. When set to weld mode the machine reaches maximum engine speed as soon as there is minimum contact between the tip of the electrode and the piece to be welded and also when set to generation drawing a minimum of 250 – 300 W. The machine returns to minimum 6/7 seconds later if power is not drawn during welding or generation.

### Checking and adjusting idling speed

- Check idling speed when COLD;
- When the engine is switched on it reaches maximum speed; after 6/7 seconds it decreases automatically to idle. Check the speed when the engine idles;
- The idling speed corresponds to 33-35 Vdc (only for Italy 42-45 Vdc) at the welding sockets or the equivalent at 2000-2200 rpm.


### Minimum welding voltage TOO LOW

- From Fig. 1 proceed as follows:
  - when the machine idles (engine cold)
  - Keep pin A locked (8 mm spanner) and unscrew nut B (7 mm spanner)
  - Again with pin A locked, turn nut C clockwise (7 mm spanner) 1 - 3 mm: The more it is extended the more the idle speed increases
  - Tighten nut B on pin A and check the idling speed.

### Minimum welding voltage TOO HIGH


- From Fig. 1 proceed as follows:
  - When the machine idles (engine cold)
  - Keep pin A locked (8 mm spanner) and unscrew nut B 1-3 mm (7 mm spanner)
  - Again with pin A locked, turn nut C anticlockwise (7 mm spanner) until nut B touches pin A
  - Tighten nut B against pin A and check that the idling speed is correct.


## Adjusting the maximum engine speed

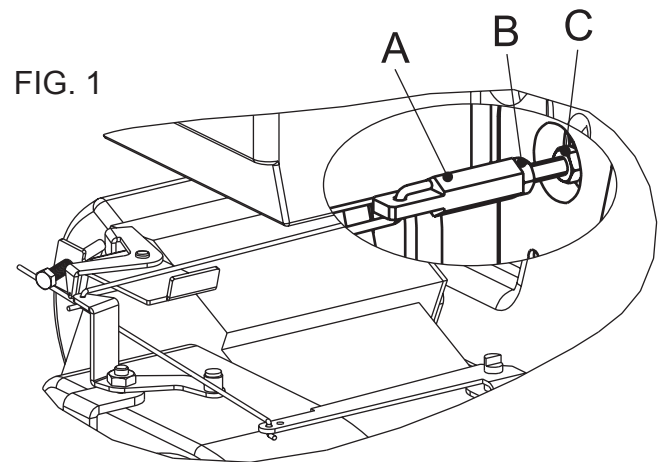

To check that the maximum engine speed is correct simply measure the welding voltage (under no-load conditions) at maximum engine speed which must be 49-51 V (only for Italy 66-68 Vdc).

Turn screw (A) to adjust the engine speed Fig. 2. Turning the screw clockwise increases the idling speed, screwing it anticlockwise decreases the maximum engine speed.

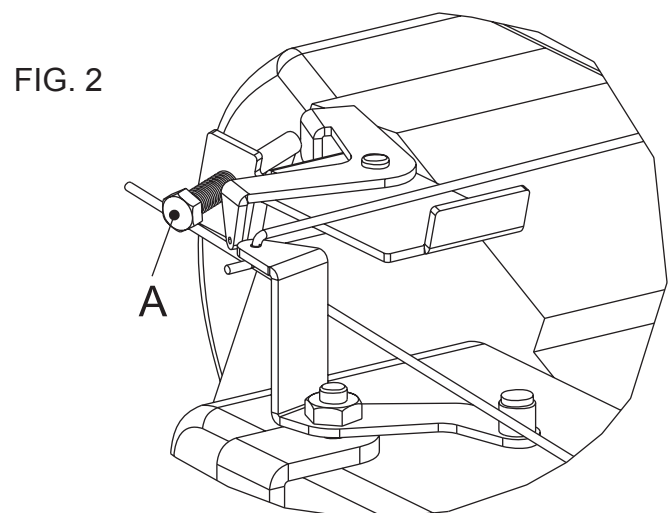

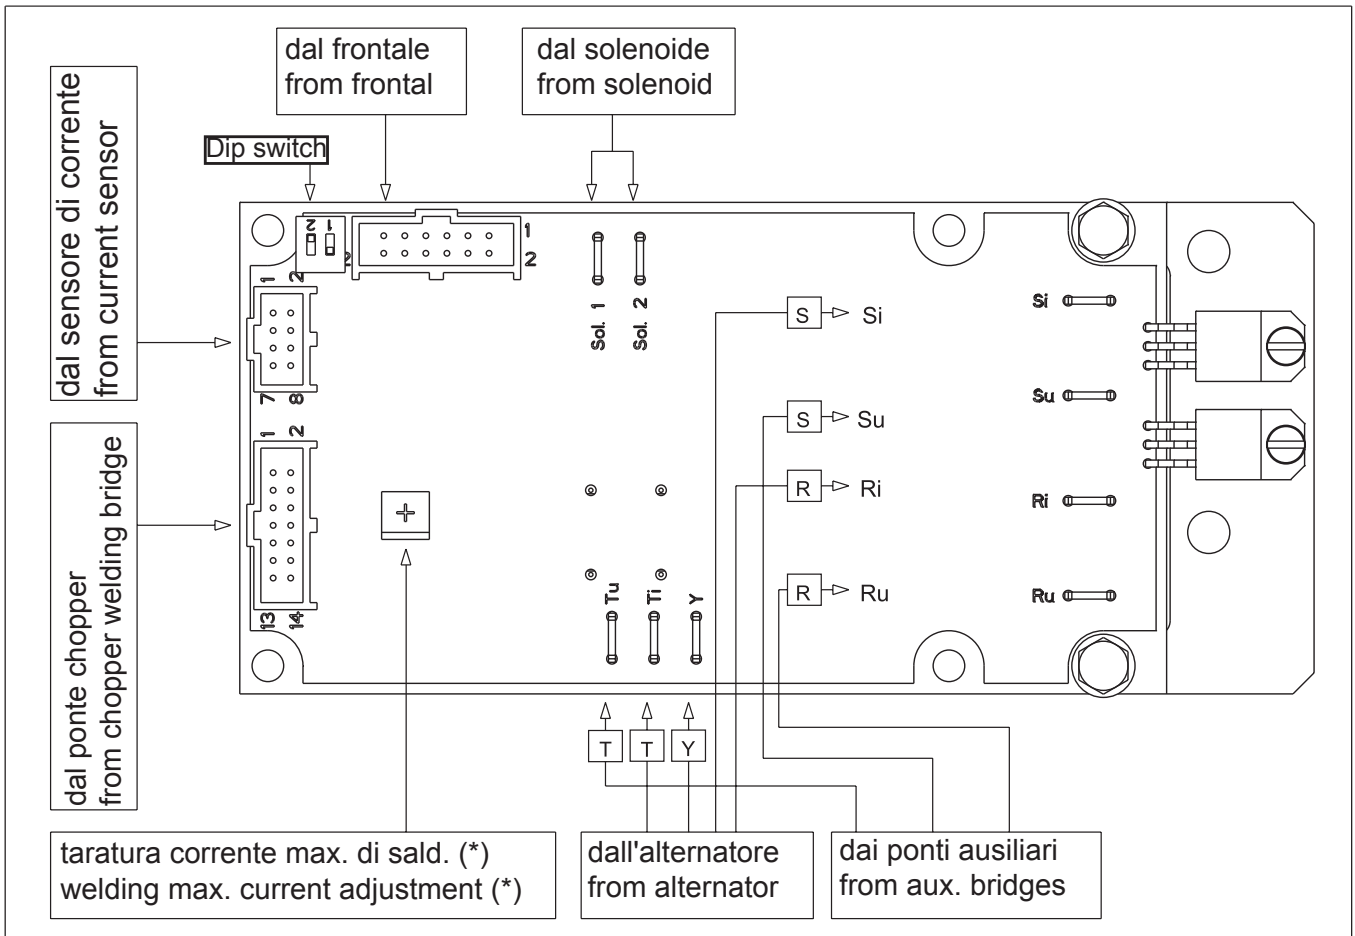

\*) Tutte le volte che viene sostituita o la scheda o il sensore di corrente è necessario procedere ad una verifica della massima corrente di saldatura e eventualmente procedere ad una sua taratura nel seguente modo:

- Lasciare fissato il frontale solo con la vite centrale inferiore e non stringerla in modo che il frontale nella sua parte superiore rimanga staccato di circa 7-8 cm.
- Ruotare il trimmer sulla scheda tutto in senso antiorario.
- Porre i dip switch secondo la figura **Dip switch**
- Verificare che al minimo del potenziometro corrisponda il minimo della manopola.
- Porre la manopola di saldatura al minimo e avviare il motore. Lasciare che la macchina vada al minimo poi fare un corto circuito tra il + e - tramite i cavi di saldatura.
- Ruotare la manopola di saldatura al massimo.
- Ruotare lentamente il trimmer in senso orario affinché la corrente di saldatura arrivi a 140A.

\*) Every time either the board or the current sensor is changed, it is necessary to check the max. welding current and, if it is the case, to set it as follows:

- Keep the front panel fixed with its lower central screw and don't tight it, so that the front panel in its upper part can have a gap of 7-8 cm.
- Rotate the trimmer on the board fully anticlockwise.
- Put the dip switch as drawing **Dip switch**
- Check that to the minimum of the potentiometer corresponds the minimum of the knob.
- Put the welding knob to the minimum and start the engine.
- Let the machine idle, then shortcircuit between the + and - welding sockets through the welding cables.
- Rotate the welding knob to the maximum.
- Slowly rotate the trimmer clockwise so that the welding current reaches 140 A.




How to put two machines in parallel:

from the front panels of the machines connect the two positives welding sockets(+) between themselves and the two negative welding sockets between themselves.  
To effect the connection ask for the accessory K2X150.

**ATTENTION:** use fit cables and tight at the connection point.

**How to proceed:**

- start the machine putting the two welding handles (T) in the wanted position (half of the total current);
- put in parallel with the right cables;
- proceed with welding.

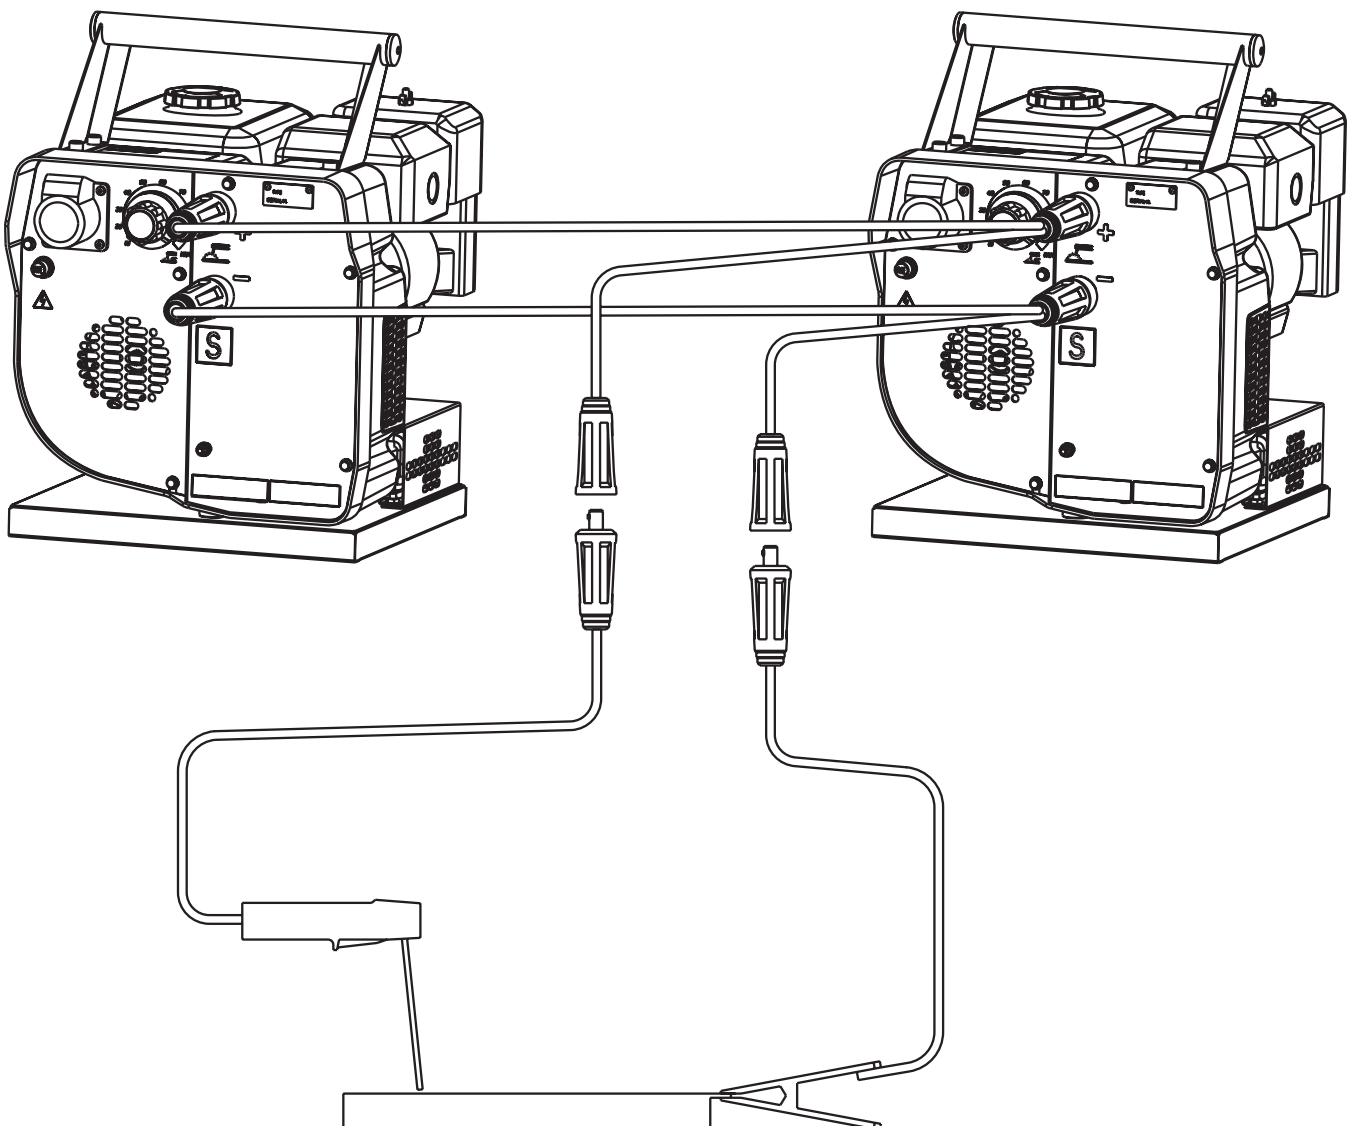



## WARNING

**It is absolutely forbidden to connect the unit to the public mains and/or another electrical power source.**


Areas for which access by non-authorized personnel is **forbidden** are:

- the control panel (at the front) - the endo-thermic motor discharge.

### GENERATION IN C.C. (CONTINUOUS CURRENT WITH MICRO-INTERRUPTION)

The auxiliary output has a 3-pin socket: the live and neutral pins are isolated while the third pin (earth) is connected to the ground of the machine via the screw on the front.

For safety, check that plugs are suitable and cables are in good condition and properly connected. Any extension cables must be 3-wire.

Using double insulated equipment is advisable, this is identifiable by the symbol  and for having no earth facility.

The unit need not be grounded, but preferably isolated so that protection is by electrical separation, which is more effective and reduces the number of connections.

If the generator is used to feed more complex circuits, or used in special environments, for example: building sites, **it is obligatory** to interpose between the socket and the loads a small distribution panel complete with electrical safeties foreseen by regulatory norms in force in matters of electrical installation.

All the tools in the manifold can be used. DO NOT use equipment with electronic speed regulation.



<b>Problem</b>	<b>Possible cause</b>	<b>Solution</b>
The motor does not start up, or starts up and then stops immediately	1) Engine switch (28) at position OFF 2) Lack of or insufficient oil in the motor 3) Faulty motor stopping device (oil-alert) 4) Lack of fuel in tank or fuel tap closed 5) Dirty or faulty spark plug 6) Cold motor 7) Other causes	1) Position switch to ON 2) Refill or top off 3) Replace 4) Refill the tank. Open the fuel tap 5) Clean or check and eventually replace 6) Hold down the CHOKE button, after start-up, for a longer period of time 7) Consult the motor Operating Manual.
No current under no-load conditions in weld mode	1) Chopper welding bridge broken 2) Faulty circuit 3) Faulty alternator	1) Use a multimeter to test that there are 3 Kohms between pins 1-2; if NOT replace the bridge 2) Replace 3) Disconnect the welding and auxiliary power cables. Use a voltmeter to check that there is 48 Vac at the outputs in weld and approximately 170 Vac in the 230 V version and 90 Vac in the 110 V version. Carry out the check when the engine idles (disconnect one of the two wires to the solenoid)
No current under no-load conditions in auxiliary power mode	1) Fuse open 2) Auxiliary power diode bridge broken 3) Faulty circuit 4) Faulty alternator	1) replace the fuse 10A retarded for version 230V 15A retarded for version 110V 2) Use a multimeter to check the 2 single phase diode bridges on the auxiliary power 3) Replace 4) Disconnect the welding and auxiliary power cables. Use a voltmeter to check that there is 48 Vac at the outputs in weld and approximately 170 Vac in the 230 V version and 90 Vac in the 110 V version. Carry out the check when the engine idles (disconnect one of the two wires to the solenoid).
Incorrect minimum voltage under no-load conditions	1) Incorrect solenoid adjustment	1) Adjust the solenoid as shown on page M34.

<b>Problem</b>	<b>Possible cause</b>	<b>Solution</b>
Incorrect maximum voltage under no-load conditions	1) Incorrect maximum engine speed	1) Adjust the maximum engine speed as shown on page M34.
Engine always at idle speed	1) Faulty circuit	1) Replace
Engine always at maximum speed	1) faulty circuit 2) Faulty solenoid	1) Replace; 2) Check that the resistance of the solenoid winding is approximately 10 ohm.
Insufficient power during welding or generation	1) Engine	1) Dirty petrol filter, dirty air filter, dirty carburetor. See engine instruction booklet.
Irregular or inconsistent welding current	1) alternator windings not insulated from earth  2) welding chopper bridge not insulated from earth  3) power cables not insulated from earth  4) faulty circuit	1) Disconnect all the outputs; 3 for welding which go to the chopper bridge and 4 for auxiliary power which go to the circuit board. Use a multimeter to check the insulation of the alternator; 2) disconnect the 3 welding cables, the + and - for welding, the black wire and the connector which go to the circuit board, Use a multimeter to check that the bridge is insulated from the earth. 3) check that the cables inside the aluminium casting, are properly insulated; 4) Replace

## RESISTENCE OF WINDING AT 20°C

	$\Omega$ (ohm)	NOTE
Output in weld mode Between green / black cable Between green / red cable Between black / red cable	0,030 0,030 0,030	All cables of the same colour are connected in parallel
Auxiliary power outputs 230 Vdc Between the black cables: R / S Between the black cables: R / T Between the black cables: S / T	1,2 1,2 1,2	Cable Y is connected to the centro stella of the three phase circuit
Auxiliary power outputs 110Vdc Between the black cables: R / S Between the black cables: R / T Between the black cables: S / T	1,0 1,0 1,0	Cable Y is connected to cable T